

Service Letter: 448, Initial Revision

Date: May 21, 2018

Title: 8KCAB Loading Schedule

Models: 8KCAB 180HP Serial Numbers 761-95 to 1177-2018

Description: The moment diagram provided in the ACAC Addendum to the Airplane Flight Manual is error with regard to the rear passenger moment. This service letter provides instructions to remark or replace the moment diagram.

Instructions:

1. Locate the loading schedule in the ACAC Addendum to the Airplane Flight Manual. Verify the date of the loading schedule page; if dated 11-21-95, 3-5-96, or 10-23-2003 proceed with step two. If otherwise dated verify the line for the passenger passes from 0lb & 0in-lb to 200lb & 9000in-lb on the moment diagram.
2. Mark the moment diagram portion of the loading schedule as superseded per SL448; appropriate marking is shown below. Insert page two of this service letter ahead of the loading schedule in the ACAC Addendum. Alternately the moment diagram can be remarked such that the line for the passenger passes from 0lb & 0in-lb to 200lb & 9000in-lb.

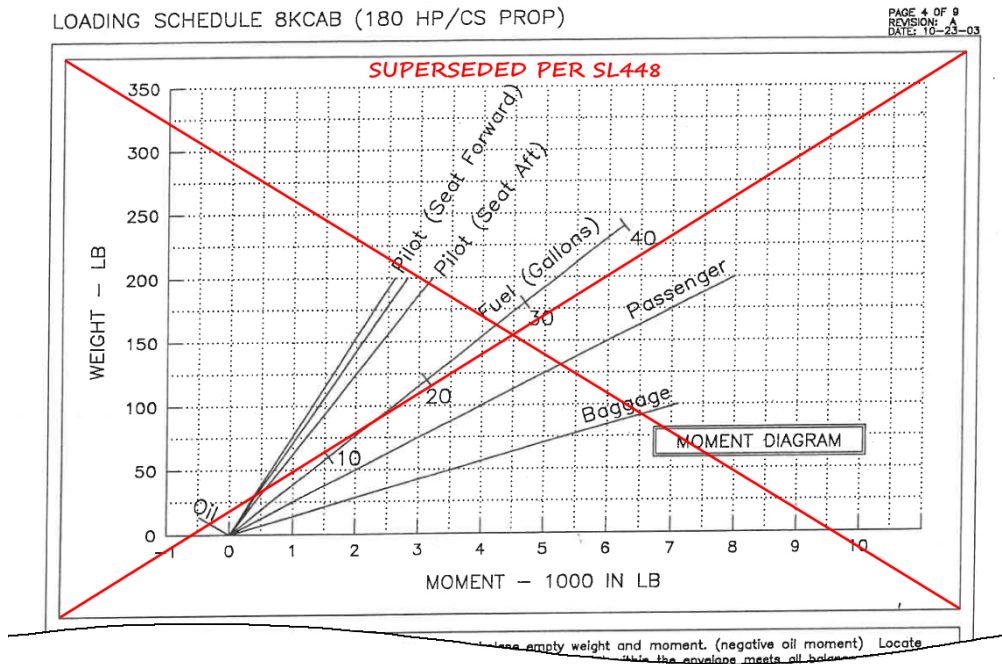


Figure 1, Superseded Loading Schedule

3. Record compliance with Service Letter 448 in the aircraft logbook.

Sample Aircraft Logbook Entry:

- Revised loading chart added to ACAC Addendum to the Airplane Flight Manual per SL448, initial rev., dated 5-21-2018.

Service Letter 448, Initial Revision, May 21, 2018

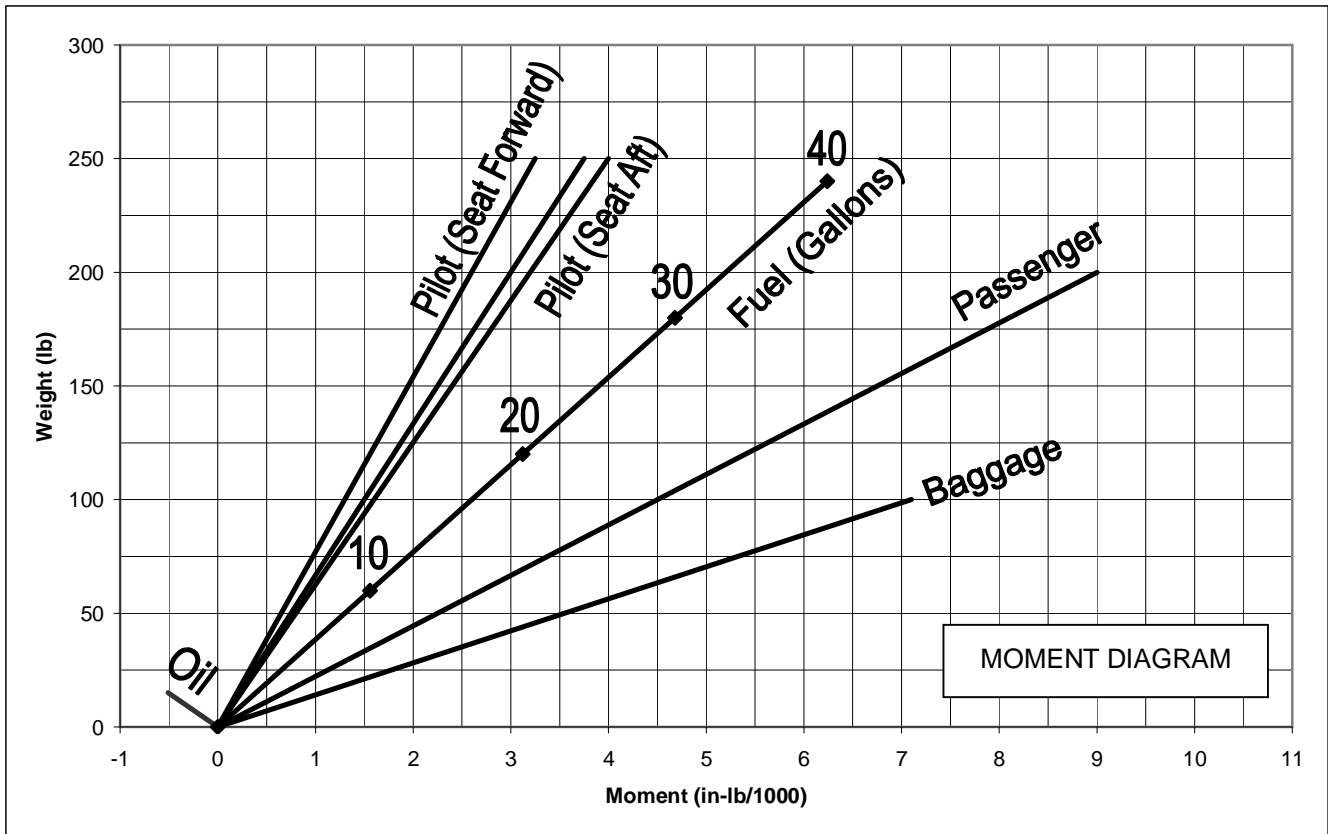


Figure 2, Revised Loading Chart